


Hall closed loop current sensor

PCB mounting. Detect DC, AC and pulse current, High insulation between primary side and the vice side circuit.







Epoxy view



Bottom view


Installation diagram


Product features

- ·Light weight
- •Low power consumption
- Good linearity
- No insertion loss
- Fast response time
- Good anti-interference ability

Product application

- Railway
- Metallurgical
- Welding machine
- Robot
- Motor
- •Inverter power supply
- · Variable frequency governor
- •Uninterrupted power supply and communication power supply

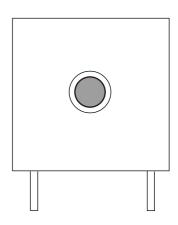

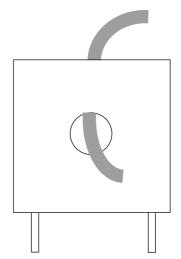



Electrical parameters: (The following parameters are typical values and actual values will be subject to product testing)

Remarks:

I _{PN}	Rated input	±20A	±50A	$\pm 50 \mathrm{A}$	±100A	±100A	Standard input can be customized
Ipm	Input measurement range	$\pm 30 \text{A}$	$\pm75\mathrm{A}$	±75A	$\pm 150 \mathrm{A}$	$\pm 150 \mathrm{A}$	The default is 1.5 times the rated input
Iout	Rated output	$\pm50\mathrm{mA}$	$\pm25\mathrm{mA}$	$\pm50\mathrm{mA}$	\pm 33.3mA	$\pm50\mathrm{mA}$	Standard output
X	Accuracy	0.5%					$I = I_{PN}$
εL	Linearity	0.1%					$\mathrm{I=0}^{\sim}\pm\mathrm{I}_{\mathrm{PN}}$
Vс	Supply voltage	\pm 12V/ \pm 15V					Supply voltage range±5%
Ιc	Current consumption	$\pm12\mathrm{mA}+\mathrm{I}\mathrm{s}$					Reference will be subject to the measured
R1	Load impedance	-					According to the sampling voltage Vout=Iout*Rl
Voe	Zero offset voltage	\leqslant \pm 0.15mA					TA=25°C
Tr	Response time	≤1 μ s					Reference will be subject to the measured
N.w	Weight	30g					Reference will be subject to the measured
Ta	Operation temperature	-25 ∼ + 70 °C					
Ts	Storage temperature	-25 ∼ + 70 °C					
Bw	Band width	DC~150KHz					Factory test according to DC
Vd	Delectric strength	3.5KV 50Hz 1min					

Instructions for use:

- 1. According to the connection mode of correct connection
- 2. The direction shown by the arrow is positive
- 3. With hole measurement, response time and following the speed for the best
- 4. Faulty wiring can lead to product damage and output uncertainty

Safe operation:


- *Please read this specification carefully before use.
- *When you need to move the product, please be sure to disconnect the power and all the connected cables.
- *If found shell, devices attached to the fixed parts, wire, or have any damaged, please immediately deal with hidden dangers.
- *If there is any doubt about the safe operation of the equipment, the equipment and the corresponding accessories should be closed immediately, and the fastest time for troubleshooting.

Proclamations:

As our products are constantly being improved and updated, we reserve the right to modify the content of this specification at any time without prior notice.




Dimensions(in mm±0.5):

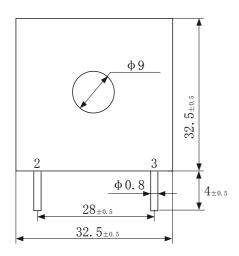

Front view


Current direction

Epoxy surface Positive



Side view

Wiring diagram:

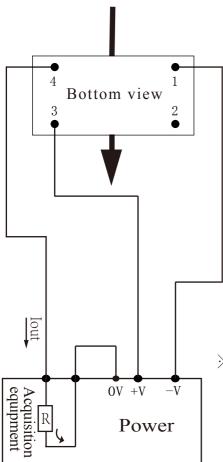

Pin definition:

1: -V

2: N.C

3: +V

4: M

X Detection:

- ①Choose the auxiliary power supply with small ripple ($\leq 10 \text{mV}$)
- ②Switch on auxiliary power
- ③The auxiliary power is connected to the sensor
- 4)The sensor detects the primary current