

Digital output current transmitter


Split core、Crimping terminal output. Detect DC and pulse current, High insulation between primary side and the vice side circuit.




Product features

- Light weight
- Low power consumption
- Good linearity
- No insertion loss
- Fast response time
- Good anti-interference ability


Installation diagram

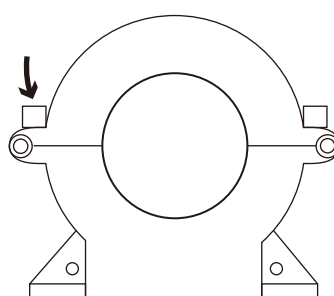


1. Loosen the screw

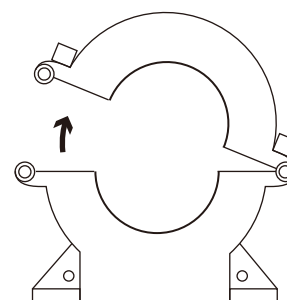

2. Open up

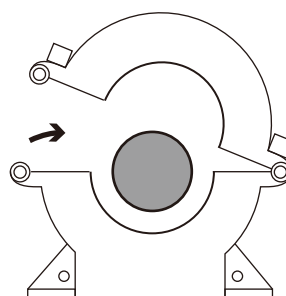

3. In the lead

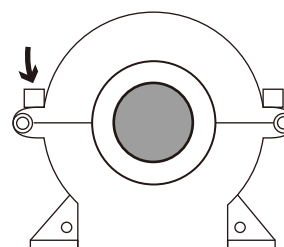

4. Tighten the screws

Product application

- Railway
- Metallurgical
- Welding machine
- Robot
- Motor
- Inverter power supply
- Variable frequency governor
- Uninterrupted power supply and communication power supply

Electrical parameters: (The following parameters are typical values and actual values will be subject to product testing)

Remarks

Rated input	400A	500A	600A	800A	1000A	1500A	2000A	Standard input
Input measurement range	480A	600A	720A	960A	1200A	1800A	2400A	Default is 1.2 times the input rating
Rated output	Hexadecimal measurements							
Accuracy	1 %							
Linearity	0. 5 %							
Supply voltage ($\pm 5\%$)	$\pm 15V/+12V/+24V$							Choose three
Current consumption	$\leq 50mA$							Reference will be subject to the measured
Transmission distance	$\leq 1000m$							
Zero offset TA=25 C	$\leq \pm 15mV$							
Response time	$\leq 20ms$							500 m transmission line, baud rate is 56000bps, even check test results
Communication protocol	RS485 Modbus RTU							
Baud rate	9600bps(Acquiescence)							14400bps/19200bps/38400bps/56000bps(optional)
Device address range	0X01(Acquiescence)							0X01~0XF7(Can be modified)
Check digit	Parity check(Acquiescence)							Odd check/no check (optional)
Weight	650g							
Operation temperature	$-10 \sim +70^{\circ}C$							
Storage temperature	$-40 \sim +85^{\circ}C$							
Band width	DC							Factory test
Delectric strength	2. 5KV 50Hz 1min							

Instruction for use:

1. Correct wiring as indicated
2. Full scale measurement, response time and following the speed for the best
3. Faulty wiring can lead to product damage and output uncertainty


Safe operation:

- *Please read this specification carefully before use.
- *When you need to move the product, please be sure to disconnect the power and all the connected cables.
- *If found shell, devices attached to the fixed parts, wire, or have any damaged, please immediately deal with hidden dangers.
- *If there is any doubt about the safe operation of the equipment, the equipment and the corresponding accessories should be closed immediately, and the fastest time for troubleshooting.

Proclamations:

As our products are constantly being improved and updated, we reserve the right to modify the content of this specification at any time without prior notice.

Dimensions(in mm±0.5) :

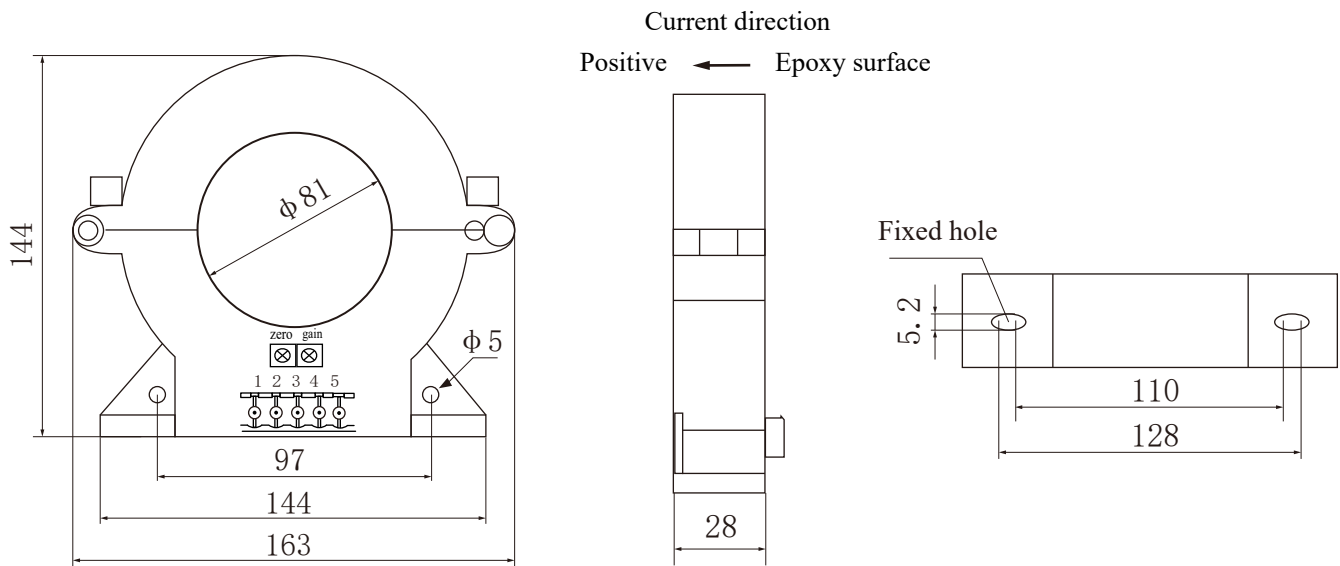


Connector Illustration:



Crimping terminal plug, spacing 5.08 mm

Wiring diagram:

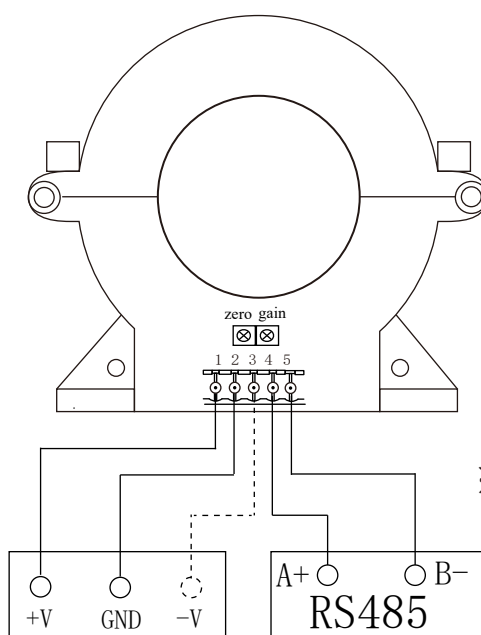

Single power terminal definition: Double power terminal definition:

1: +V
2: GND
3: N.C
4: A+
5: B-

1: +V
2: GND
3: -V
4: A+
5: B-

Potentiometer definition:

Left: zero
right: gain

※①Choose ripple small ($\leq 20\text{mV}$)
Stabilized auxiliary power supply

②Switch on auxiliary power

③Auxiliary power supply connection transmitter

④The transmitter detects primary current

Communication protocol and instructions **YHDC**®

Model: THST080D-RS485

Power supply:

Rated input:

Check bit: Parity check

Baud rate: 9600bps (Acquiescence)

Device address: 0x01 (Acquiescence)

Output signal: The serial communication RS485 interface is adopted, the transmission mode is semi-duplex asynchronous, the starting bit is 1 bit, the data bit is 8 bits, the stop bit is 1 bit, the data transmission rate is 9600bps. Use RTU mode in MODBUS communication protocol.

Read data command

COMMAND (To command) :

01 03 00 01 00 01 D5 CA

RETURN (Return information) :

0x01 0x03 0x02 0x0X 0xXX 0xXX 0xXX

Address of
slave device

Function
code

Register
number

Data
height

Low
data

CRC-L

CRC-H

Start bit	Device address	Function code	Data	CRC	Check end
T1-T2-T3-T4	8Bit	8Bit	n↑ 8Bit	16Bit	T1-T2-T3-T4

After the upper computer issues the instruction, the slave device will normally respond within 50mS, and in extreme cases, the response time will not exceed 120mS.

Input/Output Table (theoretical value) :

Current input (A)	RS485 output	corresponding decimal number
20%	0X0_ _ _ _	_ _ _ _
40%	0X0_ _ _ _	_ _ _ _
60%	0X0_ _ _ _	_ _ _ _
80%	0X0_ _ _ _	_ _ _ _
100%	0X0_ _ _ _	_ _ _ _
120%	0X0_ _ _ _	_ _ _ _

Note: (1) The input/output correspondence shall be negotiated between the manufacturer and the customer, and the signed version shall prevail

(2) 1V corresponds to the decimal number 1000 and the RS485 output is 0X03E8

2V corresponds to the decimal digit 2000, RS485 outputs 0X07D0

Note: Please ensure that the upper and lower parts of the sensor are tightly connected so that the measured data are accurate; The sensor is accurately calibrated before leaving the factory, and the user generally does not need to re-calibrate.